

BLT 35-90

rosin free, no residue wave soldering flux for Lead free and Tin Lead and rework



DESCRIPTION

BLT 35-90 incorporates the latest developments in flux activation technology for Lead Free and Tin Lead soldering applications without requiring post cleaning.

BLT 35-90 is halide free, rosin/resin free and has been formulated to provide rapid wetting, excellent top-side hole fill and minimal solder ball generation.

BENEFITS

- Halide Free
- Foam or Spray application
- Lead Free recommended, low activity range
- J-STD004 ORLO classification
- Excellent wetting and advanced sustained synthetic activity
- Reduction of solder balls caused by porous solder resists
- No residue
- Wide operating and heat activation window
- Suitable for Ni/Au, Ag, Sn, OSP and HASL boards
- Class 1, 2 and 3 manufacture
- Can be cleaned using semi aqueous solutions
- No white residues or tacky oily films
- Twelve months shelf life

PHYSICAL PROPERTIES

Colour	Water white
SG @ 20°C	• 0.805
Acid value	• 16
Solids content	• 2.0%
Flash point	• 12°C
Silver chromate paper test	• Pass
Copper mirror test	• Pass

PROCESS CONTROL


Maintain SG at 0.805 by the addition of 16-3000 thinner Change the flux if the acid value falls below 12.

APPLICATION

CIRCU

BLT 35-90 should be applied by spray, foaming or dipping and is supplied ready for use. Following are guidelines for spray applications.

Parameters	Recommendations
Spray nozzle	Medium
Top side pre-heat	90 - 150°C
Conveyor speed	0.8 - 1.6m/minute
Conveyor angle	6 - 7°
Solder contact time	2 - 5 seconds (optimum for Lead Free 2-4 secs)
Solder bath temperature	Lead Free 260 - 280°C Tin/Lead 63/37 240 - 250°C

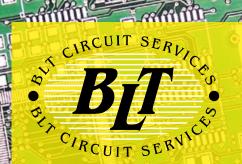

BLT 35-90

rosin free, no residue wave soldering flux for Lead free and Tin Lead and rework

CORROSION AND ELECTRICAL TESTING - SUMMARY

Test	Method	Required	Results
Surface insulation resistance	ANSI-IPC-J-STD004A IPC-TM-650 2.6.3.3	Cleaned and uncleaned >100Mohms	Cleaned and uncleaned >100Mohms See detailed results
Copper mirror	IPC-TM-650 2.3.32	No breakthrough	No breakthrough
Qualitative halide	IPC-TM-650 2.3.33	No discolouration	No discolouration
Corrosion	IPC-TM-650 2.6.15	No corrosion	No corrosion
Electromigration resistance	IPC-TM-650 2.6.14.1	Cleaned and uncleaned <1 decade drop	Uncleaned <1 decade drop See detailed results

CORROSION AND ELECTRICAL TESTING - DETAILED

Surface Insulation Resistance. ANSI-IPC-J-STD004A. IPC-TM-650. 2.6.3.3

	Conditions	Required	24 hours	96 hours	168 hours
Pattern down uncleaned	85°C/85% RH	1.0 x 10 ⁸ min	1.42 x 10 ¹⁰	7.42 x 10 ¹¹	2.97 x 10 ¹¹
Pattern up uncleaned	85°C/85% RH	1.0 x 10 ⁸ min	5.59 x 10 ⁹	1.19 x 10 ¹¹	4.94 x 10 ¹⁰
Control board	85°C/85% RH	2.0 x 10 ⁸ min	3.28 x 10 ¹¹	5.38 x 10 ¹¹	3.63 x 10 ¹⁰


All readings are in ohms.

CORROSION AND ELECTRICAL TESTING - DETAILED ANALYSIS CARRIED OUT BY INDEPENDENT CERTIFIED TEST HOUSE - TRACE LABORATORIES - USA.

IPC ELECTROMIGRATION RESISTANCE

Electromigration Test ANSI-IPC-J-STD004A. IPC-TM-650. 2.6.14.1

	Conditions	Required	Initial reading - 96 hrs	Final reading - 596 hrs
Pattern down	65°C/85% RH 596 hours	Less than 1 decade drop	5.38 x 10 ¹⁴	4.37 x 10 ¹⁴
Control	65°C/85% RH	Less than 1 decade drop	7.09 x 10 ¹¹	5.84 x 10 ¹²

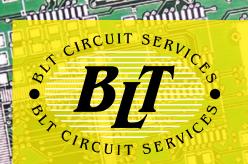

BLT 35-90

rosin free, no residue wave soldering flux for Lead free and Tin Lead and rework

PROBLEM SOLVING

000000000000000000000000000000000000000		
Symptoms	Cause and solution	
Bridging	Too high conveyor speed, insufficient flux, excessive pre-heat or solder contamination	
White residue	Excessive flux, under cured solder mask, solder contamination	
Solder balls	Excessive flux, insufficient pre-heat	
Discoloured joints	Contamination from board or components, excessive heat, solder contamination	
Incomplete soldering	Uneven flux coverage, solder wave not level or jig problem	

HANDLING PRECAUTIONS

BLT 35-90 contains Isopropyl Alcohol and is highly flammable. Use in a well ventilated area and keep away from heat and naked flames. Take precautions to avoid static build up and discharge. Refer to seperate Health and safety sheet.

Warranty

All reasonable endeavours have been made to ensure that the information contained in this data sheet is accurate, but it is submitted on the express condition that BLT Circuit Services Ltd., shall be under no liability whatsoever in respect thereof or for any loss, injury, damage or liability of whatsoever nature arising, suffered or incurred as a consequence of its use.



BLI Circuit Services Ltd Brome Industrial Estate Brome, Eye, Suffolk, IP23 7HN England

Telephone +44 (0)1379 870870 Fax +44 (0)1379 870970 Email sales@blt.keme.co.uk Web www.bltcircuitservices.co.uk